

LEGIONELLA RISK ASSESSMENT

THE PREVENTION AND CONTROL OF LEGIONNAIRES' DISEASE



Client:	Wessex RF & CA
Site:	Marine Academy Platoon
Address:	Marine Academy, Trevethick Road, Plymouth, Devon, PL5 2AF
Risk Rating:	MEDIUM
Report Ref:	AQST/LRA/342
Surveyed By:	D.Fletcher
Survey Date:	08/02/2024
Report Date:	23/02/2024
Written By:	E.Holt
Checked By:	J.Rooney
Recommended Review Date:	February 2026



Contents

- 1. Executive Summary
- 2. Summary of Recommendations and Risk Rating
- 3. General Precautions and Actions
- 4. General Site Information and Scope of Risk Assessment
- 5. Lines of communication and responsibility
- 6. Survey Details
- 6.1 Mains Water Supply Survey
- 6.2 Other Assets
- 6.3 Cold Water Storage Tank Survey
- 6.4 Hot Water Storage Vessel Survey
- 6.5 Showers
- 6.6 Dead legs
- 6.7 Point of Use Water Heaters
- 6.8 Fire Hoses.
- 6.9 Water Softeners
- 7. Outlets Sheet
- 8. Domestic Water Schematic Drawings
- 9. Photographic Evidence
- Asset Register Summary
- 11. Water Treatment and hygiene experience and training details
- 12. Legislations

Appendix A - Legislation and Codes of Practice

Appendix B - Summary of Approved Code of Practice

Appendix C - ACOPL8 (Revised) and HSG274 Parts 1, 2 and 3 summary









1. EXECUTIVE SUMMARY

This document is intended to identify the risk of developing legionnaire's disease from the building water system. The Health and Safety Executive Approved Code of Practice recommends Risk Assessments should be reviewed on a regular basis and in accordance with the current ACOP recommendations.

The Health and Safety commission issued an Approved Code of Practice for "Prevention of Legionellosis (including legionnaires' disease)" which came into effect on 15th January 1992, requiring a risk assessment to be undertaken. Guidance notes were issued by the Health and Safety Executive in the form of HS(G)70 and on the 8th January 2001 the Approved Code of Practice L8 came into force and BS8580:2019. This risk assessment is structured around the requirements of these documents, ACOPL8 revised and HSG274 Parts 1, 2 and 3 and The Water Regulations Guide.

Legionellosis is the term used for infections caused by legionella pneumphila and other bacteria from the family Legionellaceae. Legionnaire's Disease is a pneumonia that principally effects those who are susceptible due to age, illness, immunosuppression, smoking etc. and may be fatal. Legionellae can also cause less serious illnesses that are not fatal or permanently debilitating but which can affect all people. Infection is attributed to inhaling legionellae, either those water droplets which are small enough to penetrate deeply into the lung, or in droplet nuclei (particles left when water has evaporated). Legionellae are widespread in natural sources of water. They may enter man-made systems or water services, where they can multiply under certain conditions, and if there is a means of creating the transmitting water droplets, people in the vicinity may be at risk. Between 200-400 cases of legionellosis are reported in England and Wales every year.

For a risk to be present a chain of events has to occur:

- * System infection
- Legionellae proliferation enhanced by system conditions
- * Aerosol formation
- * Inhalation of aerosol by susceptible individual

Since aerosol formation and inhalation is difficult to avoid the onus falls on the operator to prevent system infection and to eliminate conditions in which legionellae thrive. The aim is to reduce the risk to an acceptable level by controlling the conditions necessary for proliferation of the bacterium. As a general rule, in practice this means: Keeping the hot water storage temperature at greater than 60°C, maintaining cold water temperatures at less than 20°C, keeping water systems clean and in good condition and controlling contamination of the water systems. It is, however, understood that some small systems, particularly when instantaneous water heaters are being used as a hot water source, may not be able to achieve these parameters and further recommendations will be given as required.

In order to achieve this aim, a detailed legionellosis risk assessment has been carried out, the results of which are used to produce recommendations for the control of the bacterium.

Full details of the required actions are enclosed.







This risk assessment does not involve the preparation of the written scheme of control, but rather provides information that is critical to its preparation, improvement, and review.

Ensuring that there is a written scheme of control is a legal requirement of the duty holder, though they might instruct the risk assessor to advise or prepare the scheme of control on their behalf as a separate commission. It is important that operation and maintenance individuals are consulted.

The survey and assessment were conducted by David Fletcher of Aquastat on 08/02/2024 on behalf of Wessex RF & CA.

This risk assessment only covers those water systems identified and made accessible to the assessor at the time of the survey.

Location:

The site is situated on a main road in a residential area can be accessed onn school grounds through staff car park

Site Description:

2 x Brick and White rendered buildings being used as a Cadet Training facility.

Site Layout:

The site comprises of kitchen, gents, ladies and disabled toilets.

Mains Cold Water Services (MCWS):

Mains enters into the boiler room and feed a combi boiler.

Cold Water Storage Tank(s) (CWST) and Cold-Water Down Services (CWDS):

None on site.

Hot Water Storage Vessel(s) and Hot Water Systems (HWS):

None on site.

Thermostatic Mixer Valves (TMV) and Thermostatic Mixer Taps (TMT):

Six TMVs and 1 TMT.

Showers and Spray Outlets:

None on site.









Water Heaters:
Combi boiler on site feeds all hot water outlets.
Expansion Vessels:
None on site.
Water Softeners:
None on site.









2. SUMMARY OF RECOMMENDATIONS and RISK RATING

This Risk Assessment has been carried out to ascertain the possible risk of contracting Legionellosis, including Legionnaires' disease, from water systems and to identify the maintenance activities required to control or prevent the risk from Legionella, including any remedial works that may be required to improve upon the findings of this assessment.

The water systems throughout this building, unless otherwise stated, have been surveyed utilising the specific asset survey forms within section six of this assessment. Each question is answered and, depending upon the survey findings, a risk score is allocated utilising the matrix below.

This matrix is designed to indicate possible risk or problematic areas within the assets or water systems.

Multiple questions will be asked for all aspects of the water asset or services present on the site.

The results from these questions will then be scored upon the risk of Legionella. The key to this scoring is:

KEY

	Risk Level	Action	
N/A	The risk from Legionella is not applicable under normal operating conditions.	No action required for the control of Legionella. Other remedial actions may be applicable.	
LOW	There is a low risk under normal operating conditions.	No additional actions required above ensuring compliance with ACoP L8	
MEDIUM	There is a medium risk under normal operating conditions.	Implement risk reduction measures in compliance with ACoP L8 e.g.: Remedial Works or Control Scheme.	
HIGH	There is a high risk under normal operating conditions.	Implement Immediate or more radical risk reduction measures e.g. Emergency disinfection. / System changes or prohibition of use.	

Where Legionella management and training is insufficient or lines of communication are not established, which are quantifiable on the surveyor's experience and knowledge.

The assessor will use the knowledge of others as well as his own technical knowledge in the judgement of the water systems assessed within this document.

We cannot guarantee that all pipe work passing underground or through floors, walls and ceilings has been traced, and it is possible that certain system dead-ends or dead-legs may not have been identified. As a result, the schematic diagram(s) contained within this report only details the visible or assumed pipe work.

Whilst every effort has been made to ensure the accuracy of the content of this document, Aquastat will accept no responsibility for any omissions that are not included.









OVERALL SYSTEM RISK STATUS

The susceptibility of personnel upon this site to the cause and effects of Legionnaires' disease have been assessed within the known range for specific Legionella susceptibility. Understandably, not every person has been interviewed to their susceptibility. Therefore, assumptions have been made as appropriate, based upon visual observations and communication during this assessment.

Population Profile		
Health of Users	Generally fit and healthy	
Property Occupancy	Cadet Training Facility	

Risk Assessment		LOW 1-2	MEDIUM 3	HIGH 4-5
Are conditions suitable for multiplication of bacteria including Legionella Pneumophila? E.g. where optimum temperatures for microbial growth and stagnation occur, e.g. dead legs and infrequently used outlets.			3	
Are nutrients present within the system? E.g. sludge, scale, rust, algae and other organic matter.		1		
Is there a means of creating and disseminating breathable droplets? E.g. aerosol generated by a shower.		1		
Are high risk groups using the water services? E.g. persons over the age of 45, those with impaired or underlying health issues and compromised immune systems.			3	
Are control systems in place and checks currently being carried out? E.g. Is monitoring being carried out at correct intervals? is it effective? Have there been positive legionella cases identified?				4
Risk Factor	12	MEDIUM		

Low 5-11; Medium 11-19; High 19+

Important Note:

Low risk does not mean no risk and all recommendations highlighted within this document should be addressed.

It remains the responsibility of the Duty Holder to ensure that the risk assessment remains valid at all times, any significant changes to the systems/type of occupancy/management structure may warrant a new assessment to be undertaken. Contact Aquastat if further advise is required.









RECOMMENDATIONS & REMEDIAL ACTIONS REQUIRED

SYST	TEM TYPES	RISK
		RATING
	HOT AND COLD WATER SYSTEMS:	
1.	Ensure that Flexi Hoses are WRAS approved	HIGH
	Actioned date: Company/initials:	
	TMVs AND TMTs:	
2.	 Disabled WC has a TMV feeding a TMT – suggest removing TMV testing if TMT works as it should. If not, return TMV in situ and fit a standard pillar tap. Temp in to TMV 51.8. Out to TMV 41.5 and 37.8 at TMT 	
	Actioned date: Company/initials:	
3.	 Several TMVs faulty – possibly a pressure issue. Suggest taking 3 x gents TMVs out, repiping and putting 1 x TMV in their place under WHB 2. Boxwork will need to be removed/replaced. 	
	Actioned date: Company/initials:	
4.	. Ladies TMVs – recommendations as per Number 3 above.	
	Actioned date: Company/Initials:	
5.	An annual TMV Servicing to be completed which is properly logged	
	Actioned date: Company/Initials:	
	GENERAL: Control Schemes	
6.	Flushing in the building is being completed every 2 weeks but no temps are being taken or recorded. Suggest completion of monthly temps and not flushing as building is in regular use therefore only needs flushing during periods of inactivity	
	Actioned date: Company/initials:	







LOG BOOK DOCUMENTATION/RECORD KEEPING

PREMISES :

Is there a water hygiene log book on site	YES		
If yes - please confirm the following:			
Where is the log book located?		Held by Scott Henshaw	
Name and position of person responsible for log book?	Scott Hens	haw	
Has this person received the appropriate training in Legionella Control & is there evidence	YES	Completed on- line course	
Does the log book contain a copy of the existing Legionella Risk Assessment?	YES	Dated 27/07/21	
Does the log book contain written scheme for Legionella control?	YES		
Are there any non-conformances outstanding from		NO	
previous Risk Assessments			
Are monthly temperature checks being taken and regularly recorded?		NO	
Is there an attendance log sheet in the book?	YES		
If applicable are showers being dismantled, cleaned and		N/a	
disinfected on a regular basis and regularly recorded?			
Are CWST's and Hot Water Storage Vessels being monitored on a 6 monthly or Annual basis?		N/a	
If applicable are little used outlets being flushed weekly and regularly recorded?	YES		
If applicable are mixer valves being serviced on an annual		NO	
basis and regularly recorded?			
If no log book on site, please advise the following:			
Is the log book held at a different location?			
If yes - please give name of responsible person and full			
address and telephone number			
Is there an asset register on site?		Within LRA	
Are Safety Data Sheets held for chemicals associated with		NO	
Legionella control?			

If there is no log book on site, or held at a different location this represents a non-compliance with the Approved Code of Practice

All records and inspection reports should be kept in the site legionella control logbook for a period of 5 years

If the log book is held at a different premises, it is the duty of the responsible person to ensure the above checks are carried out and fully recorded.









Control Scheme	Is it Actioned	Carried out by whom	Frequency	Is it logged	Comments
Infrequently used outlet flushing	Yes	Scott Henshaw	Every 2 weeks	Yes	Required Weekly
Hot and cold sentinel outlets temperature monitoring	No				Required Monthly
Hot and cold representative outlet monitoring	No				Required Monthly
Hot Water Storage Vessel flow and return temperature monitoring	No				Required Monthly
TMV servicing	No	Completed this visit by D.Fletcher			Required Annually
Strainer cleaning	No	Completed this visit by D. Fletcher		No	Required annually
Risk Assessment	Yes	Aquastat	As per LRA Review Date		This assessment replaces out of date LRA
Log Book Audit	No				Log book required for implementation of control schemes
Regular reviews of Control schemes, Training and competency.	No				Required
Sampling (Legionella or TVC)	No	Completed this visit by D.Fletcher			As Required





3. GENERAL PRECAUTIONS AND ACTIONS

The list below indicates the essential practical maintenance/management actions for which the head of site is responsible for ensuring.

- 1. Operate hot water systems at or above the approved minimum temperature. Storage should be above 60°C. Outlet (tap) temperatures should be above 50°C (unless fitted with a thermostatic mixing valve (TMV). Terminal fittings or communal showers in buildings used by young children/the very old and those with sensory loss should be supplied with water through thermostatic mixing valves so that the temperature of the water discharged at the outlets does not exceed 43 degrees C.
- 2. Maintain cold systems at or below the approved maximum water temperature. It is acceptable for the temperature to be 2°C greater than the incoming mains water temperature. However, this should not exceed 25°C.
- 3. Infrequently used outlets should be removed and any dead legs capped off at the main circulation or added to a flushing regime. Where showers are required and retained, they are to be run at least once per week or if possible, daily. Shower heads should be cleaned and disinfected in accordance with HSG274 at least on a quarterly basis.
- 4. Avoid the creation of unnecessary aerosols of water.
- 5. Ensure that the system is cleaned and disinfected if you become aware of any activity or occurrence, which you believe, may jeopardise water hygiene. Should a disinfection be required an Aquastat representative could advise?
- 6. Maintain records of temperature checks regular temperature checks should be taken from selected tap outlets after one running minute. A standard UKAS calibrated thermometer held under the water flow is all that is needed. The temperature should be recorded in the legionella log book. The results recorded on a simple temperature record table. When temperatures consistently fail to comply with the approved ranges your water hygiene company should be contacted for further guidance and advice.
- 8. When the site is unused for more than 72 hours it is advisable to run hot and cold tap outlets on entry to the building to ensure stagnant water is removed from the pipework before use. **
- 9. After plumbing (i.e. new water heater or pipework alterations etc.) have been carried out, the site should be chlorinated to BS8558 standard it may be necessary to fit an injection point to enable this process.
- 10. All outside bib taps should be fitted with a double check valve to prevent back flow.
- 11. Buildings with mixtures of lead, copper and iron pipework should be considered for refit in the long-term budget.
- 12. Dedicated drinking water tap should be clearly labelled.









- 13. Intermittently Used Buildings:
- ** On entry to a building after period of closure one senior nominated person should ensure the following before any personnel are allowed to use the water systems.
- a. The furthest tap from the mains entry point should be turned on and flushed this will ensure that any water lying dormant within the building or trapped in the feed pipe from the mains supply is thoroughly flushed and allowing the cold water to attain towns water temperatures at outlets. Approximately 2-3 minutes constant running of a mains tap if the building is close to the towns water stop tap, or 10 minutes if over 100yds should be sufficient.
- b. Instantaneous water heaters are not designed to store hot water at 60 degrees as the guidelines suggest but we would recommend that the heaters are turned on and allowed at least 5 minutes for the temperature to rise to over 45 degrees C before use.
- 14. Positive Legionella Results
- 14.1 Positive Legionella results from a water system are reported to the client's responsible person by the fastest means available. This is usually a telephone call or email which will be confirmed by emailing the laboratory's analysis report and setting down in writing the initial corrective measures that we and/or our client should be undertaking.
- 14.2 The corrective measures advised will depend on individual circumstances and will be based on the guidance notes form HSE's ACOP HSG274 Parts 1,2,3 and will be instigated as quickly as possible after receiving an order from client.









4. GENERAL SITE INFORMATION

Building Description and type of use	2 x black brick and white rendered buildings
Approx. number of occupants and overall age	
group	Up to 45 persons – 4 x evenings per week 2 x ACF, 2 x ATC
Normal operational hours of this building	08.00hrs – 17.00hrs
On site contact name at date of LRA	Scott Henshaw

SCOPE OF RISK ASSESSMENT

- Non-intrusive Site inspection visit of the agreed survey site to determine the current condition and usage of plant associated with domestic water systems on site.
- Non-intrusive Site inspection visit of the agreed survey site to determine the current condition of the management control of plant associated with domestic water systems on site.
- Produce a written report to relay the results generated from the site visit.
 Produce a site-specific asset register.
 Produce a site-specific and up to date schematic of the water systems of the survey site.

The temperatures have been taken and recorded from all areas that were accessible to the assessor during the survey; however, in larger complex buildings a representative number of temperatures may only be taken and recorded.

The following areas of the site have not been assessed:

Location:	Assets:	Reason:
N/a		

These listed water systems will only be assessed for risk of Legionellosis and not for any other factor.

The extent of the Risk Assessment is reliant on information supplied from site at time of survey and on observable conditions.

Whilst every effort has been made to ensure the accuracy of the content of this document,

Aquastat will accept no responsibility for any omissions.









5. LINES OF COMMUNICATION AND RESPONSIBILITY

At this site the following key contacts have been identified.

Duty holder: Individu	NAME all with the legal responsibility to	ADDRESS ensure that health and safety is i	TEL NOS
.,	Mark Armstrong	Wessex RF & CA Mount House Mount Street Taunton TA1 3QE	01823 217940 wx-estatesn@rfca.mod.uk
	esponsible person: Individual of Ider for ensuring that for the continuous that fore the continuous that for the continuous that for the continuous		pted responsibility under the ed to carry out tasks are competent
	Kelvin Walker	Wessex RF & CA Mount House Mount Street Taunton TA1 3QE	01823 217940 wx-estatesn@rfca.mod.uk
Deputy on site respo	nsible person: In a large unde	rtaking there may be more than c	one responsible person
Deputy on site responsible person	Scott Henshaw	Marine Academy Platoon	07834 252560
Water Supply Company	South West Water	Peninsula House, Rydon Lane, Exeter, Devon, EX2 7HR	03443 461 010
Mechanical contractor or Maintenance company	Wessex RF & CA	Mount House Mount Street Taunton TA1 3QE	01823 217940
Electrical contractor or maintenance company	Wessex RF & CA	Mount House Mount Street Taunton TA1 3QE	01823 217940
Water Treatment Company for this assessment	Aquastat	Unit N – The Old Parlour Purn House Farm, Bleadon Weston-Super-Mare North Somerset, BS24 0QE	Tel: 01934 811264 Email - enquiries@aquastat.co.uk
	1 st Company contact	Gary Ford General Manager	As above or email gary.ford@aquastat.co.uk
	2 nd Company contact	Louise Blakemore	As above or email louise.blakemore@aquastat.co.uk
Water Treatment company for Compliance tasks as per HSG274	Aquastat	Unit N – The Old Parlour Purn House Farm, Bleadon Weston-Super-Mare North Somerset, BS24 0QE	Tel: 01934 811264 Email - enquiries@aquastat.co.uk

NB: If any of the above are not available at the time of inspection it may represent a gap in management procedures which could lead to a risk of infection through miscommunication.

NNB: Any changes in the above structure must be recorded as soon as they take effect, and all parties must be notified.










6 SURVEY DETAILS:

6. 1 MAINS WATER SUPPLY REPORT

Source of supply	Towns Mains	
Number of mains cold water supply?	1	
Location of main isolation valve?	Boiler Room	
Is there a water meter installed?	No	
Is the pipework labelled?	Yes	
Materials of construction	28mm copper	
Are there any materials or fittings visibly present on the mains water system, that do not conform to the Water Regulations Advisory Scheme (WRAS) directory?	No	
Mains water temperature °C (sentinel outlets)	Nearest Tap to Incoming Main 11.3°C Furthest Tap from Incoming Main 11.0°C	
Are all other distribution temperatures that were tested within the correct temperature range? i.e. Below 20 °C?	Yes	
Are there any none flow through expansion vessels to any services on this system?	No	
Is the pipework suitably insulated?	Yes	
Does the cold-water supply have any inline filters including scale inhibitors/softeners?	No	
COMMENTS		
Mains Water Supply Risk Score	LOW	

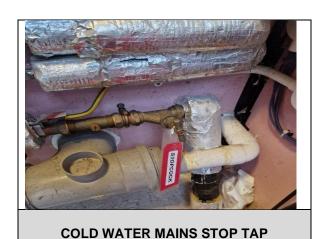









6. 2 OTHER ASSETS REPORT

Are dead legs / infrequently used outlets present within system pipework?	No
Are thermostatic mixer valves present on individual outlets?	Yes
Are there single mixer valves serving a number of outlets?	No
Is the mixed temperature of the pipework >1m?	No
Are flexible hoses fitted to any services on the mains water system?	Yes – 2
Is there any unused equipment connected?	No
Is any scale/debris present on any of the tap outlets?	No
Do any tap outlets have any spray or other inserts fitted?	No
Are strainers fitted?	On TMVs



DISABLED TMV AND FLEXIBLE HOSE



DISABLED TMV FEEDING TMV TAP



LADIES TMVS









6. 3 COLD WATER STORAGE TANK REPORT

Tank Ref : NONE ON SITE

Location	Exact location of tank	
Structure	Accurate dimensions lxwxh or dia	
	Materials of tank and any jointing's	
	Insulation type and thickness	
Lid Details	Is there a close-fitting lid	
	Is it securely fixed in place	
	Accurate dimensions for new lid	
	Separate ball valve hatch	
	Vent size has it good rodent screen	
Overflow	Size and materials of main overflow	
	Is there a rodent filter	
	Size and materials of warning pipe	
	Is there a rodent filter	
Supply	Size and materials of pipework	
	Fed from mains, softener or tank	
	Insulation type and thickness	
	ny other return or vent pipes	
Outlets	Size and Materials	Insulation type and thickness
Outlet 1		
Outlet 2		Are they valved
Drain valve	Is there a drain valve – size	
	if applicable	
Water in Tank	Temperature C Degree of sediment	
	Biological slime severe/medium/ligh	
	Extent of corrosion	
	Is there adequate crossflow within t	he
	tank? i.e. inlet opposed from outlet	
	Is the stored water over capacity??	
Labels	Is the tank labelled	
	Supply sipe labelled or coded	
	Outlets labelled or coded	
Operation	How far to adequate drain	
	Power supply – volts/distance	
	Is lighting adequate	
	Access limit ht x w	
CWST Risk Score		Low / Medium / High







6.4 HOT WATER STORAGE REPORT

HWSV Ref : NONE ON SITE

Location of hot water storage vessel	
Construction	
Size of hot water storage vessel	
Horizontal/vertical	
Storage/non-storage	
Main heat source	
Supplementary heating	
Insulation type	
Is there an open vent	
Is there an Expansion Vessel	
Size of Expansion Vessel	
IS there a flow through Valve fitted?	
Is there a drain fitted & what size?	
What size is access hatch	
Is there a drain valve – if yes give size	
Does drain valve work	
Condition of water from drain valve	
Size and materials cold feed pipe	
Is cold feed valved	
Fed from mains, tank or softened	
Pressure gauge leading	
Temp from main gauge on hot water flow	
Temp from gauge on sec return flow	
Safety valve size	
Is system circulated by sec return (yes/no)	Single/duplex
Is calorifier circulated	
Anti-stratification Pump (yes/no)	
Has pump got a time clock	
If yes – how many hours is it set in any 24	
Isolating valves on flow/return	
Is calorifier labelled	
Is pipe work coded/labelled	
Power supply voltage/distance	
How far to adequate drain	
Periods of availability for working	
Access limit Height x width	
Temperature from nearest hot outlet	
Hot Water Storage Vessel Risk Score	Low / Medium / High





6.5 SHOWERS & SPRAY OUTLETS

Site : NONE ON SITE

SHOWERS/SPRAY HEADS

Location	Nos of showers	Dismantled/ cleaned and disinfected YES/NO	Overall condition	Any repairs replacements	Regularity of Use
			/_		
CORADAENITO					
COMMENTS:		_/_			





6.6 SCHEDULE OF DEAD LEGS/BLIND ENDS

site NONE ON SITE

LOCATIONS	SYSTEM	ACTION

6.7 POINT OF USE WATER HEATERS

EXPANSION VESSEL INFO

Water Heater	Location	Make/model and capacity of each heater	Mains or tank fed	Full clean possible	Is there a pressure vessel	If yes – make model and size and
ID					– Yes/No	whether fitted
Number						horizontally or vertically
CMB01	Boiler Room	Worcester	Mains	No	No	



For information purposes:

- A. All cold water should be stored at less than 20 degrees C.
- B. All hot water should be set to produce at least 45 degrees C at outlets after one running minute.
- C. Temperatures between 20 degrees C at 45 degrees C produce ideal breeding ground for bacteria and should be avoided at all times.









6.8 FIRE HOSES

Fire hoses were not located on this site.

6.9 WATER SOFTENER

Water Softeners were not located on site.









7. WATER OUTLETS: SITE: Marine Academy

Lacation	Sentinel	Sink WHB WC Other Shower Bath Temperature		ture	Flexible	Expansion	TD 41//-	Mains	Tank	Hot	LIM Course						
Location	/Rep Outlet	Sink	WHB	T/M	Otner	Shower Bath	Snower Bath	Hot	Cold	Blended	Hose	Vessels	TMV's	Тар	Тар	Тар	HW Source
Disabled Toilet	NH NC	-	1	1	-	-	-	51.8	11.3	41.5	2	-	1+ TMT	1		1	TMV + TMV Tap + CMB01
Gents Toilet	-	-	3	2	3 x UR	-	-	52.0	10.8	46.5	-	-	3	3	-	3	CMB01
Ladies Toilet	-	-	2	2	-	-	-	51.6	42.2	10.8	-	-	2	2	-	2	CMB01
Kitchen	FH FC	1	-	-	-	-	-	52.0	11.0	-	-	-	-	1	-	1	CMB01







Water Outlet Legend:

UR = Urinal
DWF = Drinking Water Fountain
HBT = Hose Bib Tap
TMV = Thermostatic Mixing Valve
ESH = Electric Shower
QFL = Quick Fill Link

SNK = Sink

EXP = Expansion Vessel CM = Coffee machine

RH = Rinse Hose SPB = Spray Booth SO = Steam Oven

BIB = Bib tap

WHB = Wash Hand Basin
TSH = Thermostatic Shower
CWD = Chilled Water Dispenser
WSM = Washing Machine
HWB = Hot Water Boiler
CAL = Calorifier
BE = Blind Ends
STR = Strainer
MSH = Mixer shower
CO = Combi Oven
INF = Infrequently

BID = Bidet

TB = Tea Boiler

WC = Water Closet
WH = Water Heater
VM = Vending Machine
DSW = Dish Washer
CMB = Combi Boiler
PRU = Pressurisation Unit
DL = Dead Leg
EWC = Electronic Water Conditioner
DWT = Drinking Water Tap
FC = Fume Cupboard
CDU = Chemical Dispensing Unit
HWSV = Hot Water Storage Vessel








8. LINE DRAWINGS OF WATER SYSTEMS SITE: MARINE ACADEMY PLATOON

NB: Due to the complexity of the pipe work at this site it is not possible to ensure the total accuracy of these line drawings. They may require revision.

MARINE ACADEMY PLATOON

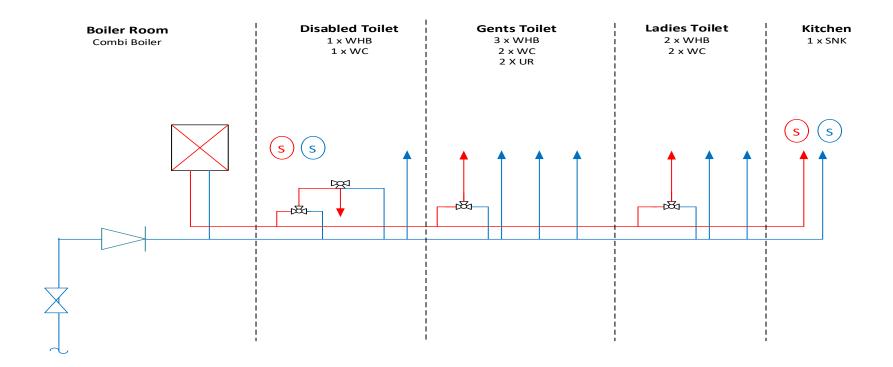










SCHEMATICS KEY

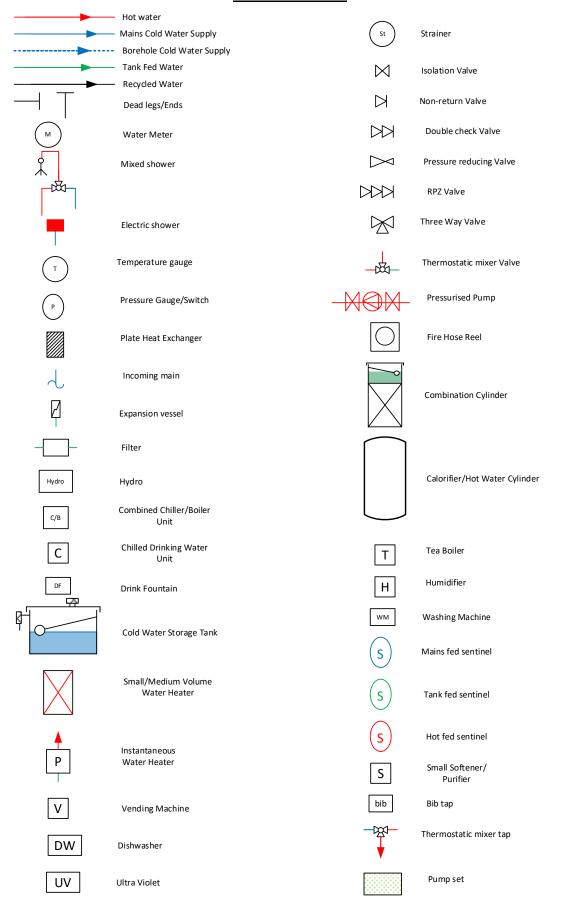








9. OTHER PHOTOGRAPHS

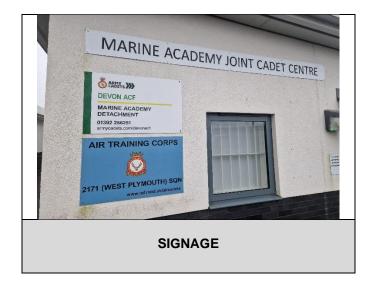









10. ASSET REGISTER SUMMARY

Asset:	Asset Number of:		
Outlets	14		
Sentinel outlets	4		
Infrequently used outlets	0		
Cold Water Storage Tanks	0		
Hot Water Storage Vessel	0		
Plate Heat Exchangers	0		
Combi Boilers	1		
Point of Use Water Heaters - >15 Litres	0		
Point of Use Water Heaters - <15 Litres	0		
Instantaneous Water Heaters	0		
Combination Water Heaters (Fortic style)	0		
Combination Water Heaters with Storage (FBM style)	0		
Water Softeners	0		
Showers 0			
Rinse Hoses	0		
Spray Outlets	0		
TMVs	6		
TMTs	1		
Strainers	12 (in TMVs)		
Flexible Hoses	2		
Expansion Vessels	0		
Pumps	0		
RPZ Valve	0		









11. Water Treatment & Hygiene Experience and Training Details

All personnel undertaking water treatment and hygiene works must only be carrying out their duties if they are suitably qualified, trained and competent to do so. Details of the assessor for this risk assessment are recorded below:

Persons name:	David Fletcher
Job description:	Engineer/Assessor
Company:	Aquastat
Experience:	21 years within the water treatment service industry
Training/Competence:	BS5 The Disinfection of water supply systems within buildings (<i>Develop</i>) –
	June 2007
	Disinfection of water system within building (City & Guilds) – July 2007
	Operatives – Health & Safety Test (Construction Skills) – February 2008
	Asbestos Awareness (BSG) – January 2009
	Confined space training including introduction to breathing apparatus
	(Bristol International Fire & Safety Training Dept) – February 2009
	Operatives – Health & Safety Test (Construction Skills) – May 2011
	Asbestos awareness course (UKATA) –
	May 2012
	First aid at work (St John Ambulance) – September 2012
	Confined Space Training (Bristol International Fire & Safety Training Dept)
	Nov 2013
	Operatives – Health & Safety Test (Construction Skills) Sept 2014
	Risk Assessment of Water systems – Water Management Society - Oct
	2014
	Water Quality in Building Water Systems and Legionella Awareness Course
	(Aquadition) January 2015
	Practical Legionella Risk Assessment (Water Management Society) Sept
	2015
	Practical legionella risk assessment (Water Management Society, City and
	guilds) 22/09/2015
	Dewey Waters Sectional GRP tank installation May 2018
	SSSTS CITB 27/02/2018 Exp:28/02/2023
	Confined Space Medium Risk 28/02/2018
	Asbestos Awareness 01/02/2018
	City & Guilds – Disinfection of hot and cold water systems within buildings
	11/07/2019
	WS8 Legionella Risk Assessment of Commercial Hot and Cold Water
	Systems 22/09/2021
	Emergency First Aid at Work 11/10/2021
	Confined Space Medium Risk 19/10/2021
	Legionella Training: Control In Hot & Cold Water Systems (HXT-W04) 27/06/2022
	UHW10 Domestic Hot Water Storage Systems (Unvented) 20/04/2023

Certification for all the above are held at Aquastat offices.









12. Legislation and Codes of Practice

References

- 1 Health and Safety at Work etc Act 1974 (c.37) The Stationery Office 1974 ISBN 978 0 10 543774 1
- 2 Control of substances hazardous to health (COSHH). The Control of Substances Hazardous to Health Regulations 2002 (as amended). Approved Code of Practice and guidance L5 (Sixth edition) HSE Books 2013 ISBN 978 0 7176 6582 2 www.hse.gov.uk/pubns/books/I5.htm
- 3 The Management of Health and Safety at Work Regulations 1999 SI 3242/1999 The Stationery Office
- 4 Reporting accidents and incidents at work: A brief guide to the Reporting of Injuries, Diseases and Dangerous Occurrences Regulations 2013 (RIDDOR) Leaflet INDG453(rev1) HSE Books 2013 www.hse.gov.uk/pubns/indg453.htm
- 5 The Notification of Cooling Towers and Evaporative Condensers Regulations 1992 SI 1992/2225 The Stationery Office
- 6 Consulting employees on health and safety: A brief guide to the law Leaflet INDG232(rev2) HSE Books 2013 www.hse.gov.uk/pubns/indg232.htm
- 7 Legionnaires' disease: A guide for duty holders Leaflet INDG458 HSE Books 2012 www.hse.gov.uk/pubns/indg458.htm
- 8 Managing for health and safety HSG65 (Third edition) HSE Books 2013 ISBN 978 0 7176 6456 6 www.hse.gov.uk/pubns/books/hsg65.htm
- 9 The control of legionella: A recommended Code of Conduct for service providers The Legionella Control Association 2013 www.legionellacontrol.org.uk
- 10 Water fittings and materials directory Water Regulations Advisory Scheme www.wras.co.uk/Directory
- 11 Water Supply (Water Fitting) Regulations 1999 SI 1148/1999 The Stationery Office

Further reading

BS 8580-1 2019 Water quality. Risk assessments for Legionella control. Code of practice British Standards Institution

BS 8558:2015 Guide to the design, installation, testing and maintenance of services supplying water for domestic use within buildings and their curtilages British Standards Institution

BS EN 806 (Parts 1-5) Specifications for installations inside buildings conveying water for human consumption British Standards Institution

Water systems: Health Technical Memorandum 04-01: Safe water in healthcare premises.

Code of Practice: Cooling water treatment Water Management Society 2007 www.wmsoc.org.uk

 $\label{lem:general} \textit{Getting specialist help with health and safety} \ \ \texttt{Leaflet INDG420(rev1)} \ \ \texttt{HSE Books 2011}$ $\ \ \texttt{www.hse.gov.uk/pubns/indg420.htm}$

Minimising the risk of Legionnaires' disease TM13 The Chartered Institution of Building Services Engineers 2013

Doc: AWRA1 -Appendix A









SUMMARY OF THE APPROVED CODE OF PRACTICE L8 (revised) and HSG274 Parts 1, 2 and 3 FOR THE PREVENTION OR CONTROL OF LEGIONELLOSIS

Any water system operating with temperatures of greater than 20C and which may release a spray or aerosol presents a reasonably foreseeable risk of Legionellosis. Experience shows that the following are the key systems, which required attention.

- Systems incorporating cooling towers or evaporative condenser.
- Hot water services
- Humidifiers and air washers.
- Spa baths and pools.
- Hot and cold water services in premises where the occupants are particularly susceptible.

For premises covered by the Health and Safety at Work Act 1974, the HSC's Approved Code of Practice requires the following:

- A risk assessment undertaken by a competent person to identify the risk of Legionellosis and any necessary and reasonably practicable precautionary measures required.
- A management plan identifying steps to be taken to minimise the risk. The plan should also identify the responsible
 persons, the lines of communication and the training and competence requirements for employees and subcontractors.
- Implementation of the plan including training.
- Record keeping to track remedial activities and to monitor performance.
- The owner should ensure that the management system performance is audited and subject to management review to keep it relevant.

The following list provides an indication of the requirement of the ACOP, which is enforced by the Health and Safety Executive or the Environmental Health Department of the local authority, depending on your premises type. Failure to comply is not in itself an offence, but failure to comply may be taken by a court as proof that the person has contravened the legal requirements.

- * Risk Assessments
- * Management plan and procedure development
- * Training of personnel
- * Remedial action such as
 - cleaning and disinfection
 - Tank refurbishment
 - Regular water treatment (chemical/plant)
- * Provision of log books
- * Regular monitoring and system maintenance including sampling analysis, chemical cleaning and disinfection.

Doc: AWRA2 -Appendix B









THE CONTROL OF LEGIONELLOSIS L8 SUMMARY FOR HOT & COLD-WATER SERVICES

L8 (Revised) and HSG274 Parts 1, 2 and 3 applies to all premises covered by the Health and Safety at Work Act 1974, where foreseeable risk of Legionellosis is present i.e. most commercial premises with a hot and cold water system

The prime focus of this document is to avoid conditions that permit Legionellae to proliferate and to avoid the creation of sprays or aerosols or where this is impracticable to minimise the release of droplets.

The conditions that promote legionellae proliferation are:

- Temperatures in the range of 20 45 C
- Presence of sediment, sludge, scale or organic matter which act as nutrients.
- Some unapproved water fittings may harbour legionella and act as a nutrient.
- High microbial levels may act as nutrients and as a host for legionellae.
- Biofilms and slimes may harbour and protect Legionellae from biocides. These are often caused by stagnant or low flow conditions.

The main areas of concern for hot and cold water services are shown in Table (1) along with some possible precautionary measures. A risk assessment should be carried out on each site and a management plan developed to minimise the risk. The management plan and its execution should be completely documented as detailed in Table (2).

TABLE 1 - TYPICAL RISKS IN HOT AND COLD WATER SERVICES

ITEM	POSSIBLE PROBLEM	OPTIONS & PRECAUTIONARY MEASURES
Storage Tank	Stagnation	Location of inlet and outlet
	Temperature>20C	Ensure tanks not too large or numerous
	Sludge and Scale build up	Insulation, or low level chlorination
	Corrosion deposits build up	Clean and disinfect on regular basis
	Ingress of nutrients	Refurbishment/Butyl lining
		Tight fitting covers and insect mesh on overflow
Softeners & Filters	Deposit builds up	Backwash regularly
	Microbiological build up	Disinfect 6 monthly or as monitoring requires
	Fitting harbouring legionella	Use approved fittings only
Calorifiers	Stratification (temp<60C)	Pumped circulation or regular thermal
	Intermittent use	Disinfection
	Scale builds up	Thermal disinfection
		Pre-treat water or descale as required
Dead legs	Fittings harbouring legionella	Use approved fittings only
(e.g., taps, showers and	Stagnation	Chlorination and flush through
other appliances)		Thermal disinfection and flush through
		Keep pipe runs short
All pipework and systems	Sludge, Scale, Debris build up	Clean and disinfect on a regular basis
		Regular microbiological monitoring (e.g.
		Dip-slide 4 - 6 per annum
		Legionella sampling annually

RECORDS FOR HOT AND COLD-WATER SERVICE

A log book with the following contents is recommended: -

- Identification of those responsible and lines of communication.
- Description and plan of the system.
- Risk Assessment.
- Operation of the system.
- Procedures for inspection and checking of the system.
- Management plan of remedial activities and records of progress.
- Records of:

Water temperatures
Record of operation, maintenance and checking
Inspection record and subsequent action.
Cleaning and disinfection record

Doc: AWRA3 - Appendix C





